

MARION COUNTY SURVEYOR'S OFFICE



SECTION CORNER RECORD

DEBRA S. JENKINS
MARION COUNTY SURVEYOR

SEC. 24 TWN. 14_N RNG. 2_E

BRYAN F. CATLIN, PLS
TECHNICAL SUPERVISOR

Date: 4-14-10
Party Chief: Wilcoxen
Crew: Finney
Type of Marker: Concrete monument with MCSO capped rebar
Method of Establishment: County: 8-28-1997
IN S.P.C. E Zone, NAD 83 (1986)
Name: 14022407
N: 486 961.819 6(m)
E: 48 290.409 4(m)

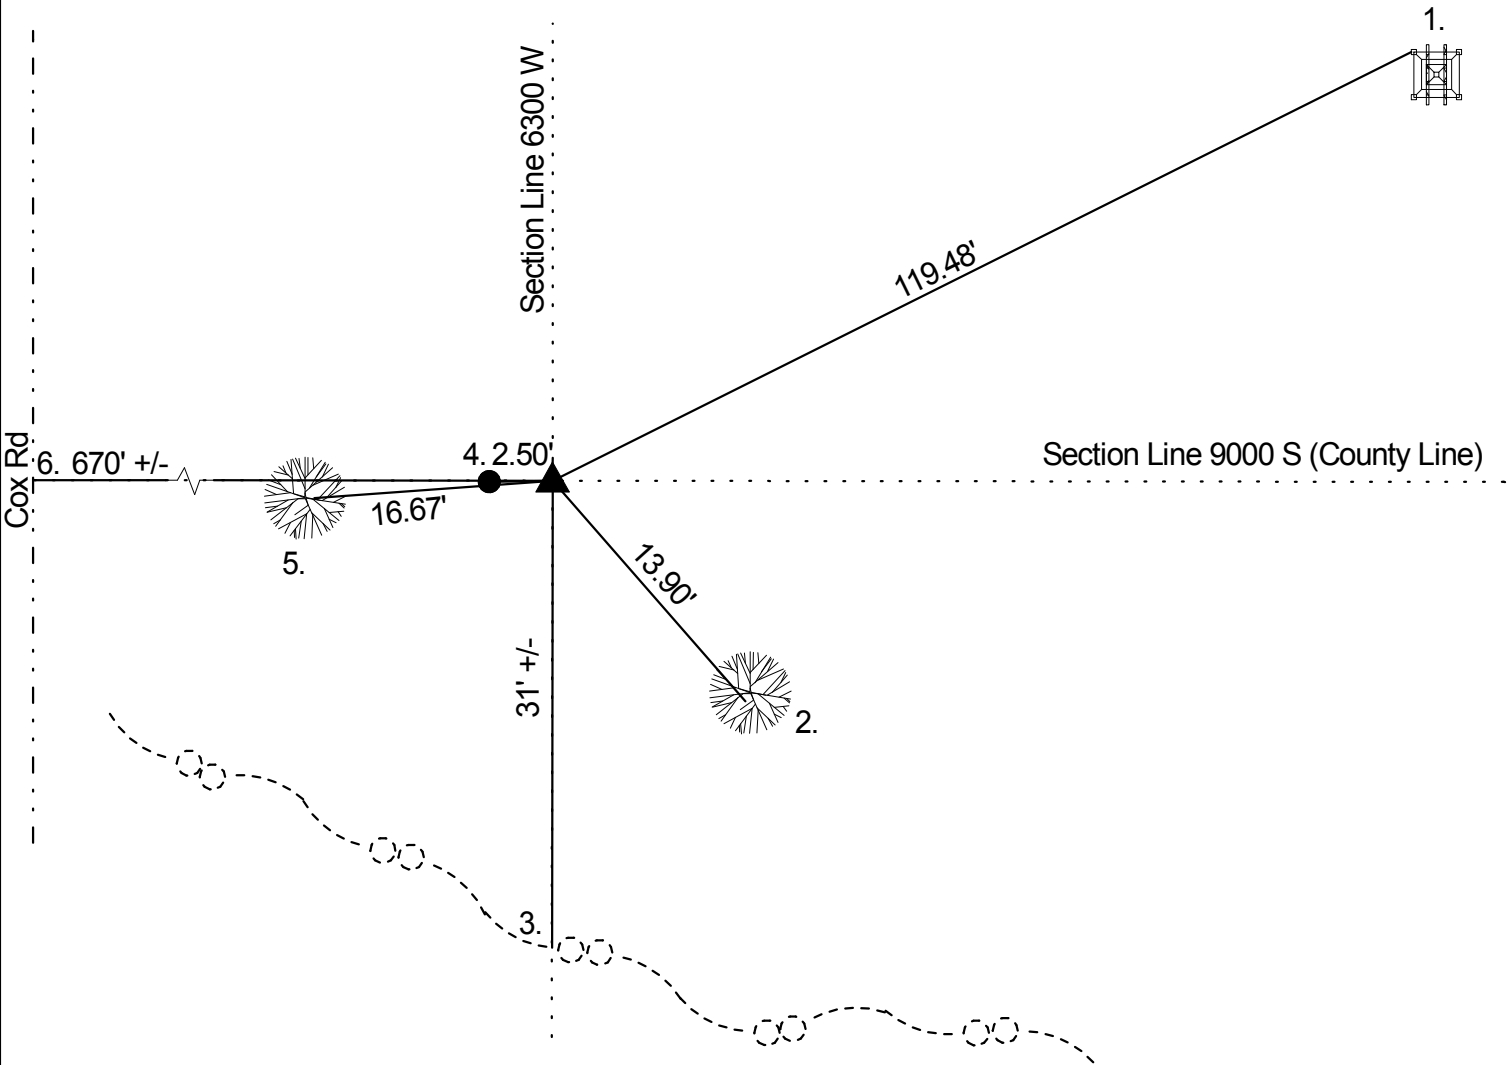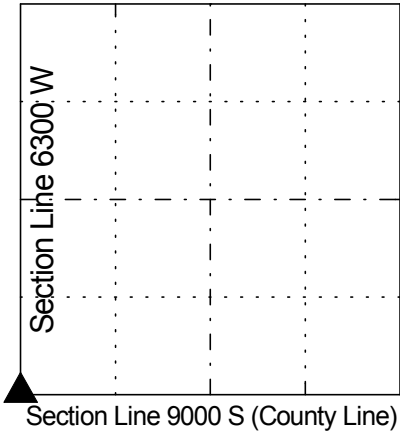

Corner originally set as a post in 1820 by Wm. B. Laughlin with witnesses: 7" Beech N 23 E 9 links and 10" Buckeye S 70 W 12 links. The SW corner Sec 24-14-2 reestablished 7-1997 by MCSO by the following methods: Decatur Township Legal Survey Book pg. 34 calls for a stone set at this location in 1893 by Paul Julian at a point 1332.8' W of the S sixteenth corner of the SW Quarter of Sec 24. Morgan County records had no reference for monumentation at this corner. A stone with no history was called as being fd at the SQ corner of Holloway Land Surveying survey job #117-90 (in 1990). A capped rebar set by Holloway fd 3' W of fence intersection and adjacent to an 8" triangular stone fd on top of the ground. After a thorough search no other stones fd in area. It is thought that the 1893 stone may have been destroyed during the relocation of a ditch S of and along the county line as shown on aerial photos of 1937 and 1962 and that the small stone fd by Holloway is not the original corner stone. The post at the fence intersection agrees with the recorded distances from the S of Sec 23, the distance to the W corner of Sec 24 and with lines of occupation. The post does not agree with Legal Survey distance to S sixteenth corner of the SW Quarter of Sec 24 (1328.3' measured, 1332.8' legal survey). Since the post agrees with the recorded N & W distance and with the occupation lines and the evidence of 1893 survey appears to have been destroyed, the MCSO believes that the post at the fence intersection is the best possible location for the SW corner of Sec. 24. 4-14-2010 Wilcoxen retied and set concrete monument per coordinates due to disintegration of post and destruction of previous ties.

| REF | DISTANCE | DESCRIPTION |
|-----|----------|---|
| 1. | 119.48' | Cut 'x' on bolt of NW leg of high tension power line 40" up |
| 2. | 13.90' | Mag nail w/brass washer 10" Ash tree 3" up |
| 3. | 31' +/- | Due S to C/L of creek |
| 4. | 2.50' | Holloway Engineering capped rebar (sign post beside it) |
| 5. | 16.67' | Mag nail w/brass washer E 24" Thorn tree spur root |
| 6. | 670' +/- | Due W to C/L of Cox Rd. |
| | | |